

Category F (01)	Applicable Model/s 1999 Miata	Subject HARD TO REFUEL	Bulletin No. 007/99
			Issued 04/02/99
			Revised

### APPLICABLE MODEL(S)/VINS

All 1999 Miata with VINs lower than JM1 NB353\* X0 123496.


### DESCRIPTION

Excessive amount of time is required when refueling the vehicle due to pump nozzle repeatedly shutting off. This may be caused by the non-return valve (one-shutter type) becoming stuck in the closed position. A modified (three-shutter type) non-return valve is now available to resolve this concern.

Customers having this concern should have their vehicle repaired using the following procedure.

### REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the non-return valve with the modified part according to the Workshop Manual (section 01-14).

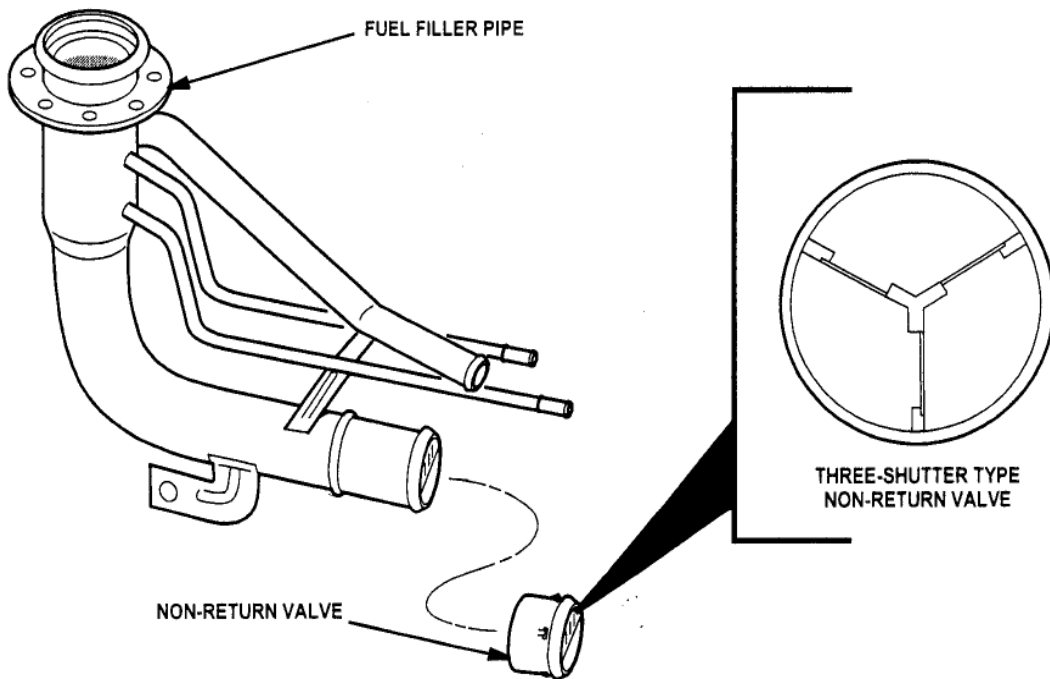

3. Verify repair.

### PART(S) INFORMATION

Part Number	Description	Qty.	Notes
GE4T 42 270	Non-return valve	1	---

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools / equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Consumers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, consumers should contact their nearest authorized Mazda dealership.