

Subject: MIL ILLUMINATED - P0455 SET	Bulletin No: 01-020/07
	Last Issued: 5/25/2007

BULLETIN NOTE

This bulletin supersedes the previous bulletin 01-020/07, issued on 05/24/07. The DESCRIPTION and WARRANTY INFORMATION have been revised.

APPLICABLE MODEL(S)/VINS

2007 CX-7 vehicles with VINs from JM3 ER**** ** 100057 to 128616

2006-2007 MX-5 vehicles with VINs from JM1 NC**** ** 111723 to 125568

2006-2007 RX-8 vehicles with VINs from JM1 FE**** ** 200012 to 208462

DESCRIPTION

Some vehicles may experience MIL illumination with DTC P0455 stored in memory due to improperly tightened fuel filler cap.

- P0455 - EVAP System Leak Detected (Large Leak)

Some fuel filler pipes may be out of specification and in some cases, may not allow the fuel filler cap to be fully tightened. As a mass-production change, the shape of the fuel filler cap screw threads of fuel filler pipe have been modified.

The completion of MSP13 will address this concern in most cases so please be sure that it has been completed first. In the unlikely event that it does not, customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the fuel filler pipe. Refer to appropriate Workshop Manual section 01-14 FUEL TANK REMOVAL / INSTALLATION.
3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
EG21-42-210E	Filler Pipe	1	CX-7
NF79-42-210D	Filler Pipe	1	MX-5
FE01-42-210F	Filler Pipe	1	RX-8

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

	CX-7, MX-5	RX-8
Warranty Type	A	A
Symptom Code	99	99
Damage Code	99	99
Process No.	A0685B	A0685B
Part Number Main Cause	SEE PART(S) INFORMATION	FE01-42-210F
Quantity	1	1
Operation Number / Labor Hours:	XXB494R1 / 0.5 Hrs.	XXB494R2 / 2.4 Hrs.