

## 2006-2013 MX-5

### *MANUAL TRANSMISSION WILL NOT SHIFT*

Some vehicles equipped with manual transmission may exhibit a no-shift concern. This may be caused by a shift lever bolt that came loose and lodged in the shifter area.

Re-install the shift lever bolts and torque them to 7.8 - 11 Nm {80 - 110 kgf cm, 69 - 95 in lb} to resolve the customer's concern.

**Special thanks to master technician Archie Campbell from Mazda of Roswell.** Archie has been rewarded with a \$50 American Express Gift Cheque for submitting this valuable technical information. Refer to page 8 for information on how to submit an M-Tip and be considered for a \$50 American Express Gift Cheque.

