

Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun
Hiroshima 730-8670, Japan
TEL : 81(82)287-5323
FAX : 81(82)287-5220



0.Category S	Repair Guidance	Ref. No. R058/17	Page 1 of 2
Coverage <input type="checkbox"/> Distributor only <input checked="" type="checkbox"/> Please inform your dealers		Date Issued August 3, 2017	
Please convey this information to your <input type="checkbox"/> Director <input checked="" type="checkbox"/> General Manager <input checked="" type="checkbox"/> Warranty Dept. <input checked="" type="checkbox"/> Parts Dept. <input checked="" type="checkbox"/> Training Dept. <input checked="" type="checkbox"/> Field Rep.		Date Revised	
Applicable Model MX-5 (ND) with Retractable Fastback		Applicable Countries and/or Vehicle Specifications Worldwide	

Subject: Middle Headliner looks loose

DESCRIPTION

Some customers may complain that middle headliner looks loose at the center rear end.



CAUSE

Due to parts variation, the middle headliner may look loose at the center rear end.

MASS PRODUCTION CHANGE

No mass production change is scheduled.

SUBJECT VIN & PRODUCTION DATE RANGE


Retractable Fastback models only

Spec.	VIN Range		Production Date Range
Australia	JM0 ND**** **	100001 - 999999	(ALL)
General (R.H.D.)	JM6 ND**** **	100001 - 999999	
General (L.H.D.)	JM7 ND**** **	100001 - 999999	
Europe (L.H.D. & UK Specs.)	JMZ ND**** **	100001 - 999999	
US (2017 MY)	JM1 NDAL** ** JM1 NDAM** **	100001 - 999999	


REPAIR PROCEDURE

When you receive a customer complaint on this concern, install an additional fastener.

1. Remove the middle headliner according to the workshop manual "MIDDLE HEADLINER REMOVAL/INSTALLATION".
2. Punch a 6 mm diameter hole (A) as shown by using a hole punch (recommended).
There is a mating hole in the middle of roof panel.

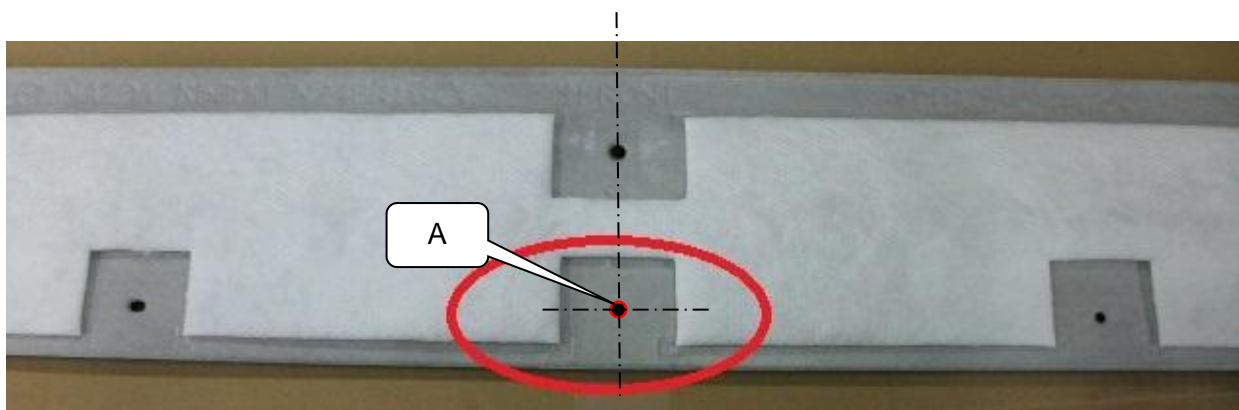

[Back view of the middle headliner]

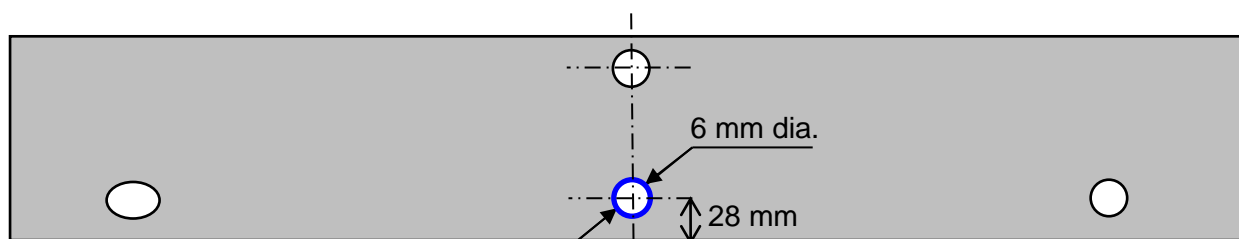

[Location of the hole]

3. Install the middle headliner with four (4) fasteners.

PARTS INFORMATION

Part Number	Description	Qty.
GJ21-68-885B 02	Fastener	1

WARRANTY INFORMATION

Assembly group	S - Body
Subassembly group	21 - SOFT TOP
Symptom Code	89 (Out of proper position)
Damage Code	99 (Special code)
Causal Part No.	N248-R1-67X
Quantity	0
Operation No. and Labor Hours	XXN7FXAX / 0.2 Hrs.
Period Covered	Normal Warranty Period
Prior approval necessary	NO

Kimiaki Inooka
Manager, Technical Information Group
Technical Service Department
Mazda Motor Corporation
1H62020645 (MC Internal Use)