

Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun
Hiroshima 730-8670, Japan
TEL : 81(82)287-5323
FAX : 81(82)287-5220




Category P	Modification	Ref. No. M001/13	Page 1 of 2
Coverage <input type="checkbox"/> Distributor only <input checked="" type="checkbox"/> Please inform your dealers		Date Issued January 25, 2013	
Please convey this information to your <input type="checkbox"/> Director <input checked="" type="checkbox"/> General Manager <input checked="" type="checkbox"/> Warranty Dept. <input checked="" type="checkbox"/> Parts Dept. <input checked="" type="checkbox"/> Training Dept. <input checked="" type="checkbox"/> Field Rep.		Date Revised	
Applicable Model CX-7, CX-9, MX-5, Mazda8(MC Product)		Applicable Countries or Specifications Worldwide	

Subject: Discontinuation of fixing screw for front disc plate

DESCRIPTION

The screws to fix the disc plate on the wheel hub have been discontinued.
With this change, the wheel hub and disc plate have also been modified to without fixing hole.

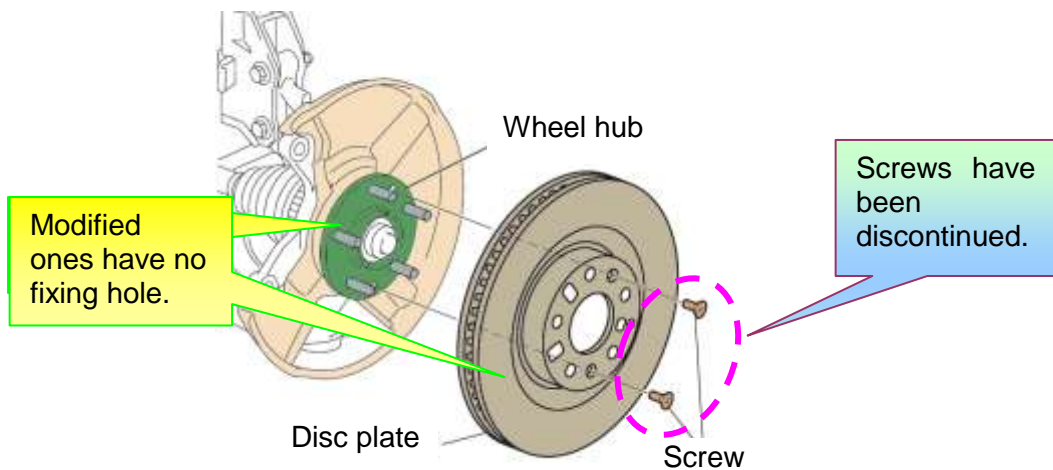

MASS PRODUCTION CHANGE

The screws have been discontinued from following VINs.

	Front disc plate	Front wheel hub	
	October 29, 2012 -	December 1, 2012 -	December 13, 2012 -
JM6 LY *****	300514 -	300531 -	
JM3 TB *****	401885 -	406093 -	
JMZ TB *****	400725 -	400468 -	
JM0 TB *****	400676 -	401577 -	
JM7 TB *****	400676 -	401577 -	
JM1 NC *****	228139 -		228957 -
JMZ NC *****	350835 -		351471 -
JM0 NC *****	203511 -		203542 -
JM7 NC *****	203511 -		203542 -

JM* ER ***** Mass production has been discontinued.

REPAIR PROCEDURE

LY, TB, NC (Before modification), ER

When you install the modified disc plate or wheel hub without fixing hole on the vehicle before the modification, you do not need to install the screws. Install the disc plate on the wheel hub, install the tires and tighten them all together with wheel nuts. You can discard the screws.

Note:

There is no problem even if screw is installed only on one side.

LY, TB, NC (After modification)

On vehicles after modification the hole on the disc plate and wheel hub is omitted. It is not necessary to use the screws accordingly.

PART INFORMATION

Modified Parts (without hole.)

Part Number	Part Name	Remark
L214-33-25X	Front disc plate	LY,ER(Gasoline engine)
TD13-33-25X		TB,ER(Diesel engine)
N12Y-33-25XB		NC
L206-33-060A	Front wheel hub	LY,ER(Gasoline engine)
TD11-33-060A		TB,ER(Diesel engine)
NE51-33-04XA		NC

Mitsunori Tokunaga
Manager, Technical Information Gr.
Technical Service Dept.
Mazda Motor Corporation
(MC Internal Use)